



FEB 0 8 2005

ABARTHOLOMEW

INSPECTION REPORT

896 cust_id

200338 insp_id

7801 site_id

EMORY UNIVERSITY

Customer ID: 896

Certificate: 57-R-0003

Site: 002

EMORY UNIVERSITY

WOODRUFF HEALTH SCIENCES CTR
1440 CLIFTON ROAD NE
ATLANTA, GA 30322

Inspection

Type: ROUTINE INSPECTION

Date: JAN-11-2005

3.75 (a)

3.75 (f)

HOUSING FACILITIES, GENERAL.

(a) Structure: construction. Housing facilities for nonhuman primates must be designed and constructed so that they are structurally sound for the species of nonhuman primates housed in them. They must be kept in good repair, and they must protect the animals from injury, contain the animals securely, and restrict other animals from entering.

***The exterior compound wall of S-4 is deteriorating. This is most notable along the second support beam to the left of the observation tower where there is a small gap in the solid metal sheeting and a hole in the chain link. Excessive swaying of this wall was observed when the animals jumped on it. The holes in the wall must be repaired and the structural integrity of the wall re-evaluated to prevent animal injury or escape. Correct by: 21 Jan 05.

***The access door of S1 as observed from the building interior is secured along the upper right side by one bolt resulting in a loose hinge. The access door of S2 is loose and missing two bolts along the lower right hinge portion. Both these hinges are excessively rusted. The access door of A3 is loose, preventing the door from closing normally. A loose or malfunctioning access door may result in animal or human injury. Correct by: 14 Jan 05.

***There is a broken metal mirror that is becoming detached from its base along the outside compound wall between T4 and T3. Debris falling into animal enclosures may result in animal injury and this item must be repaired or removed. Correct by: 14 Jan 05.

***The ceiling of the interior of T3 is peeling and separating along the pitch of the building. Ceilings and interior walls must be maintained to allow proper cleaning and sanitization of surfaces. Correct by: 30 Apr 05.

***Several outdoor compound walls are rusting along sections of the solid metal sheeting material. Although the surface area of the rust areas is small, deterioration of this material by pitting or perforation creates an avenue for animal escape. The structural integrity of this material must be re-assessed and proper adjustments made. Correct by: 30 Jan 05.

***The roof of D1/D2 is in need of repair. The shingles have shifted and buckled, exposing the underlying wood material. Buildings must be maintained to prevent animal escape or injury. Correct by: 30 Apr 05.

Prepared By:

Amy Bartholomew, DVM
AMY BARTHOLOMEW, DVM, USDA, APHIS, Animal Care

Title:

(b)(6), (b)(7)(c)

Received By:

Title:

Date:

JAN-12-2005

Date:

JAN-12-2005



FEB 03 2005

ABARTHOLOMEW

INSPECTION REPORT

896 cust_id

200338 insp_id

7801 site_id

***On the inside of M5 directly above run #4, PVC pipe housing air conduit has become detached from a wall bracket. This has displaced the protective PVC cover causing the air conduits to be exposed. An animal can reach the air conduit hoses and pull them into the primary enclosure, which can result in injury. This must be repaired to prevent animal access to the air conduit. Correct by: 14 Jan 05.

(f) Drainage and waste disposal. ...Housing facilities must be equipped with disposal facilities and drainage systems that are constructed and operated so that animal wastes and water are rapidly eliminated and the animals stay dry.

***The drains in the outdoor compounds T3 and T4 are clogged with food debris, cardboard, and enrichment devices. Drains must be maintained to allow elimination of water and waste. Correct by: 14 Jan 05.

3.77 (c)

SHELTERED HOUSING FACILITIES.

(c) Lighting. ...Lighting must be uniformly diffused throughout animal facilities and provide sufficient illumination to aid in maintaining good housekeeping practices, adequate cleaning, adequate inspection of animals, and for the well-being of the animals.

***The 2 banks of lights out at the end of the interior portion of M5. Lighting in animal areas must be uniformly diffused to promote proper husbandry practices. Correct by: 14 Jan 05.

3.80 (a X 2 X iii)

PRIMARY ENCLOSURES.

(a) General requirements.

(2) Primary enclosures must be constructed and maintained so that they:

(iii) Contain the nonhuman primates securely and prevent accidental opening of the enclosure, including opening by the animal.

***Run 2D on the interior portion of BC-2 is missing several rivets in the support structure that secures the primary enclosure chain link. This has resulted the chain link to become loose along both the upper and lower portion which may result in animal injury by entrapment or animal escape. This item was corrected at the time of inspection.

3.84 (c)

3.84 (d)

CLEANING, SANITIZATION, HOUSEKEEPING, AND PEST CONTROL.

(c) Housekeeping for premises. Premises where housing facilities are located, including buildings and surrounding grounds, must be kept clean and in good repair in order to protect the nonhuman primates from injury, to facilitate the husbandry practices required in this subpart, and to reduce or eliminate breeding and living areas for rodents, pests, and vermin.

Prepared By:

Amy Bartholomew, DVM

AMY BARTHOLOMEW, D V M , USDA, APHIS, Animal Care

Title:

(b)(6), (b)(7)(c)

Received By:

Title:

Date:

JAN-12-2005

Date:

JAN-12-2005



INSPECTION REPORT

FEB 03 2005

896 cust_id

200338 insp_id

7801 site_id

***There is an established raccoon latrine in the area below the observation tower for S6 and S7. This inhibits maintenance of sanitary conditions for animals and staff. Facilities, including surrounding grounds, must be maintained to eliminate living areas for pests. Correct by: 21 Jan 05.

(d) Pest control. An effective program for control of insects, external parasites affecting nonhuman primates, and birds and mammals that are pests, must be established and maintained so as to promote the health and well-being of the animals and reduce contamination by pests in animal areas.

***Numerous roaches are observed on the indoor portion of M3 and M1. Dead roaches have accumulated inside the ceiling light fixture housings. Effective pest control must be established and maintained. Correct by: 01 Mar 05.

COMPLETE INSPECTION OF YERKES FIELD STATION CONDUCTED 11-12 JAN 2005.

Prepared By:

Amy Bartholomew, DVM

AMY BARTHLOMEW, D V M , USDA, APHIS, Animal Care

Title: (b)(6), (b)(7)(c)

Received By:

Title:

Date:

JAN-12-2005

Date:

JAN-12-2005